



# Biuletyn Techniczny

Numer:	OSB11-04-051
Data:	2 listopada 2011
Wersja:	00

## Cruze J300 – Piszczenie tylnych zacisków hamulcowych

### Warunki:

Klienci mogą skarżyć się na piszczenie podczas lekkiego hamowania jadąc do tyłu. Dźwięk ten może być słyszany szczególnie podczas deszczu lub wysokiej wilgotności powietrza.

### Poprawka

Zainstalować zestaw tłumików (13337450)



Tłumik (2szt na auto)



Śruba tłumika (2 szt na auto)

### Części

Numer	Nazwa	Ilość	Uwagi
13337450	Zestaw tłumików	1	2 tłumiki i dwie śruby

### Informacje gwarancyjne

Kod operacji	Opis	Czas	Uwagi
4568700	Tylny hamulec – uzbrojenie [oba]	0.4	

Kod charakteru usterki: N57

Kod przyczyny usterki: R28

Numer części powodującej usterkę: 13300856

**UWAGA! Typ protokołu: 11**

This information is intended for internal use only. All information, illustrations and specifications contained in this document are based on the latest product information available at the time of issue.

UNAUTHORISED REPRODUCTION IS STRICTLY PROHIBITED.

Printed in the UK, by Chevrolet Europe Customer Care




# Biuletyn Techniczny



Numer:	OSB11-04-051
Data:	2 listopada 2011
Wersja:	00

## Procedura naprawy

1. Unieść pojazd

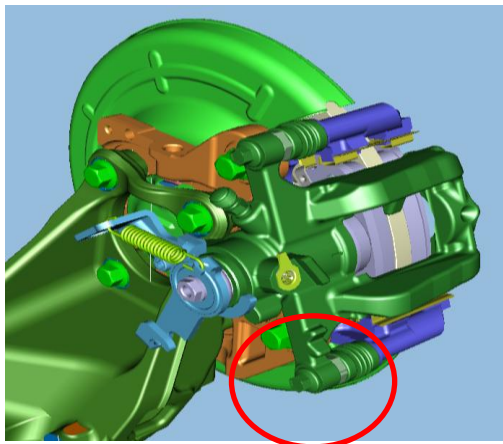

2. Usunąć dolne śruby mocujące zacis hamulca. Wyrzucić wykręcone śruby.

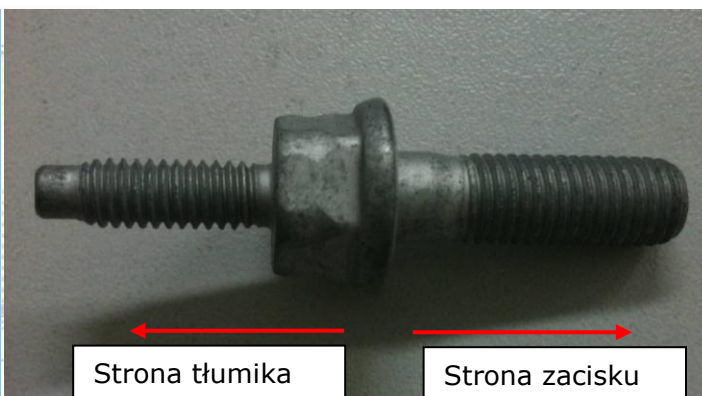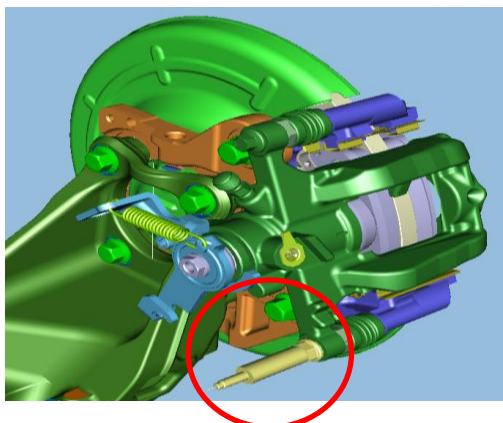

3. Zainstalować śruby mocujące tłumiki po obu stronach  
Moment dokręcenia: 28 Nm



4. Zamontować tłumiki po obu stronach (**torx**) Moment dokręcenia: 9 Nm

This information is intended for internal use only. All information, illustrations and specifications contained in this document are based on the latest product information available at the time of issue.

UNAUTHORISED REPRODUCTION IS STRICTLY PROHIBITED.

Printed in the UK, by Chevrolet Europe Customer Care